

# NEW

04/2021

19/01/2021

**TECO 710-730-740-750**



**SUBJECT: DISPLAY OF ERROR MESSAGE “E 28” - “E30”**

If the wheel balancer displays the error message “E 28” or “E 30” to signal wrong wheel encoder counting or wrong calibration of magnetic sensor of encoder “zero” notch (FO) we suggest, before performing the routine checks indicated in the service manuals, to check the type of hex head screws used to secure the pulley to the swinging unit body (figure on the side).



If these screws are black (ferromagnetic burnished steel), they must be replaced with other screws of the same size in non-magnetic STAINLESS steel (VTE M4X10).

For this purpose, the spare part **kit code 5-125305** has been created, which can be requested to our spare part department.

We remain at your complete disposal for any further information.